BABY GAUGE SENSOR BS-102 & BS-112 **INSTRUCTION MANUAL**

Thank you very much for purchasing ONO SOKKI BS-102 & BS-112 BABY Gauge Sensor. To ensure proper operation, read this manual carefully before use.

After reading, keep this manual in a convenient place so that you can consult it at any time.

Precautions for Use

- (1) Disassembling the sensor can cause misoperation. The cover should never be opened. If the cover is opened, metal cuttings, cutting oil other dirt may enter the sensor.
- (2) Keep the spindle free of oil and dirt.

The movement of spindle will be impaired if it is oiled or comes into contact with oil from the hands

To remove such oil or dirt from the spindle, use a dry cloth or soft moistened with dry alcohol. Do not use such liquids as benzene, thinner or gasoline.

Avoid leaving the sensor in high-temperature locations for long periods.

Do not apply force to the spindle in any direction other than the thrust direction. Because of the extremely precise relationship between the spindle and the shaft, if lateral force is applied to the spindle or excessive force is applied in turning the stem, the movement of the spindle will be impaired.

When replacing the measurement tip, care must be taken to avoid applying torsional force to the spindle.

- (4) Lowering and raising of the spindle should be performed by the accessory release cable. When the release is not being used, always remember to cover the mounting hole.
- Do not remove the ring from the spindle. Because the ring which is mounted to the spindle is the stopper.

Operation of the spindle

(1) Use the dedicated lifter

If the spindle is operated directly by hand, there arises a danger that dust or oil (grease) sticks on it to cause errors. To avoid this, it is recommended to use the release dedicated to BS-102&BS-112.

(2) Use the linear gauge sensor within the maximum response speed.

The maximum response speed of BS-102&BS-112 with respect to the moving speed of the spindle is 1 m/s. Moving faster than this might result in malfunction. In addition, the proper method for making the spindle touch the object to be measured is to drop the spindle after making it come within 1 mm from the object.

(3) Reference point of spindle


If the spindle is not made touch the reference plane, no accurate fixed point can be obtained. For measurement, be sure to make the spindle touch the reference plane and make this pushed condition the reference point.

How to Mount the Sensor


The following two methods may be mount the Baby Gauge Sensor.

(1) Fixing by the stem

The stem is finished to $\emptyset 8 \ ^0_{-0.03}$ mm in outer diameter. For this fixing method, prepare a mounting hole of $\emptyset8^{+0.03}_{+0.01}$ mm, and tighten carefully so that no excess force acts on the stem.

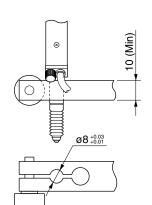

(2) Mounting by Using the Mounting Holes The Gauge may be held using either M3 panhead screws or socket-head bolts in the M3 mounting holes provided in the sensor.

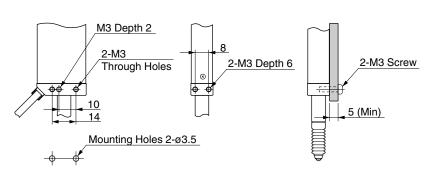


■ Specification	ons BS-102		BS-112	
Measuring range	10 mm		10 mm	
Measurement unit	10 µ m		1 µ m	
Indication accuracy	3 µ m (at 20°C)		3 μ m (at 20°C)	
Maximum response speed	1 (4) m/s *		0.2 (0.8) m/s *	
Measurement force	· /	dustpr	oof rubber boot is removed,	
	the force will be reduced to 0.98 N or less)			
Supply voltage	4.5 to 6 VDC			
Current consumption	Approx 30 mA at 5 VDC Approx 70 mA at 5 VDC			
Output signal	two-phase square wave signal			
	Phase difference: 90°±20° (at 5 VDC)			
	Hi: 4.5 to 6.0 V (in no-load condition)			
	Lo: max. 0.4 V or less BS-102:P=40 µ m BS-112:P=4 µ m			
	 P- 			
	Signal 1			
	Signal 2			
	When the spindle is p	oushed i	n When the spindle comes out	
Terminal connector	R03-PB6M(from Tajimi M Gauge sensor Signal 1 White Signal 2 Power input + Signal common Power input - Case shield Black Orange (for 1	Conn [[[[[]]]]] [[[]]] [[]] [[]] [[]] [] [[]] [[]] [[]] [] [[]] [Signal 2 Power output + Signal common terminal is not connected to the case.	
Operating temperature	+5°C to +40°C			
Storage temperature	-10°C to +55°C		o +55°C	
Cable length	1.9 m between sensor		1.9 m between sensor and	
	and counter		AMP BOX 100 mm between	
			AMP BOX and counter	
Mass Approx. 150 g including of		able	Approx. 200 g including	
			AMP BOX and cable	
Accessory	Dustproof Rubber Boot Ins		truction Manual	
Option	Finger lift	AA-96	69	
	Release AA-8		13, AA-816	
	· · · · · · · · · · · · · · · · · · ·		973(with a mesuring chip)	
Gauge stand		ST-011, ST-022		
			various probes	
			402 connection joint forexchanging	
			ring chips	
	(when AA-		n AA-973 dust-proof boot is used)	

*It is available when our digital gauge counter is used.

The value, whih is written at (), is maximum response speed when it is combined with our model DG-4140/4160.

■ Outside Drawing

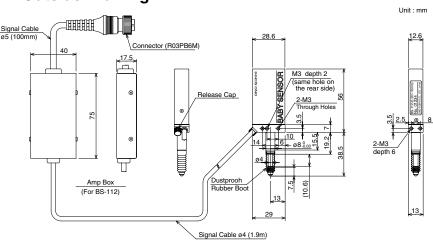

■ Omission of Test Qualification Issuance

Since this product has been tested through a series of strict inspections and a complete program of quality control, issuance of the test qualification has been omitted.

Warranty

- This product is covered by a warranty for a period of one year from the date of purchase.
- This warranty covers free-of-charge repair for defects judged to be the responsibility of the manufacturer, i.e., defects occurred while the product is used under normal operating conditions according to descriptions in this manual and notices on the unit label.
- For free-of-charge repair, contact either your sales representative or our sales office nearby.
- The following failures will be handled on a fee basis even during the warranty period.

 (a) Failures occurring through misuse, mis-operation, or modification

 (b) Failures occurring through mishandling (dropping) or transportation
- (c) Failures occurring through natural calamities (fires, earthquakes, flooding, and lightening), environmental disruption, or
- * For repairs after the warranty period expired, contact your sales representative or our sales office nearby.

ONO SOKKI

*Outer appearance and specifications are subject to change without prior notice. HOME PAGE: http://www.onosokki.co.jp/English/english.htm

WORLDWIDE

Ono Sokki Co., Ltd

1-16-1 Hakusan, Midori-ku, Yokohama 226-8507, Japan Phone : 045-935-3976 Fax : 045-930-1906 E-mail : overseas@on

BABY GAUGE SENSOR BS-102 & BS-112 **INSTRUCTION MANUAL**

Thank you very much for purchasing ONO SOKKI BS-102 & BS-112 BABY Gauge Sensor. To ensure proper operation, read this manual carefully before use.

After reading, keep this manual in a convenient place so that you can consult it at any time.

Precautions for Use

- (1) Disassembling the sensor can cause misoperation. The cover should never be opened. If the cover is opened, metal cuttings, cutting oil other dirt may enter the sensor.
- (2) Keep the spindle free of oil and dirt.

The movement of spindle will be impaired if it is oiled or comes into contact with oil from the hands

To remove such oil or dirt from the spindle, use a dry cloth or soft moistened with dry alcohol. Do not use such liquids as benzene, thinner or gasoline.

Avoid leaving the sensor in high-temperature locations for long periods.

Do not apply force to the spindle in any direction other than the thrust direction. Because of the extremely precise relationship between the spindle and the shaft, if lateral force is applied to the spindle or excessive force is applied in turning the stem, the movement of the spindle will be impaired.

When replacing the measurement tip, care must be taken to avoid applying torsional force to the spindle.

- (4) Lowering and raising of the spindle should be performed by the accessory release cable. When the release is not being used, always remember to cover the mounting hole.
- Do not remove the ring from the spindle. Because the ring which is mounted to the spindle is the stopper.

Operation of the spindle

(1) Use the dedicated lifter

If the spindle is operated directly by hand, there arises a danger that dust or oil (grease) sticks on it to cause errors. To avoid this, it is recommended to use the release dedicated to BS-102&BS-112.

(2) Use the linear gauge sensor within the maximum response speed.

The maximum response speed of BS-102&BS-112 with respect to the moving speed of the spindle is 1 m/s. Moving faster than this might result in malfunction. In addition, the proper method for making the spindle touch the object to be measured is to drop the spindle after making it come within 1 mm from the object.

(3) Reference point of spindle


If the spindle is not made touch the reference plane, no accurate fixed point can be obtained. For measurement, be sure to make the spindle touch the reference plane and make this pushed condition the reference point.

How to Mount the Sensor


The following two methods may be mount the Baby Gauge Sensor.

(1) Fixing by the stem

The stem is finished to $\emptyset 8 \ ^0_{-0.03}$ mm in outer diameter. For this fixing method, prepare a mounting hole of $\emptyset8^{+0.03}_{+0.01}$ mm, and tighten carefully so that no excess force acts on the stem.

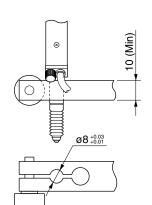

(2) Mounting by Using the Mounting Holes The Gauge may be held using either M3 panhead screws or socket-head bolts in the M3 mounting holes provided in the sensor.

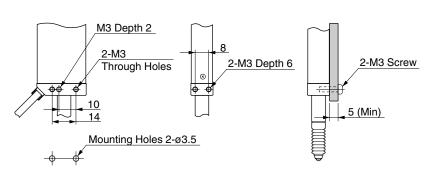


■ Specification	ons BS-102		BS-112	
Measuring range	10 mm		10 mm	
Measurement unit	10 µ m		1 µ m	
Indication accuracy	3 µ m (at 20°C)		3 μ m (at 20°C)	
Maximum response speed	1 (4) m/s *		0.2 (0.8) m/s *	
Measurement force	· /	dustpr	oof rubber boot is removed,	
	the force will be reduced to 0.98 N or less)			
Supply voltage	4.5 to 6 VDC			
Current consumption	Approx 30 mA at 5 VDC Approx 70 mA at 5 VDC			
Output signal	two-phase square wave signal			
	Phase difference: 90°±20° (at 5 VDC)			
	Hi: 4.5 to 6.0 V (in no-load condition)			
	Lo: max. 0.4 V or less BS-102:P=40 µ m BS-112:P=4 µ m			
	 P- 			
	Signal 1			
	Signal 2			
	When the spindle is p	oushed i	n When the spindle comes out	
Terminal connector	R03-PB6M(from Tajimi M Gauge sensor Signal 1 White Signal 2 Power input + Signal common Power input - Case shield Black Orange (for 1	Conn [[[[[]]]]] [[[]]] [[]] [[]] [[]] [] [[]] [[]] [[]] [] [[]] [Signal 2 Power output + Signal common terminal is not connected to the case.	
Operating temperature	+5°C to +40°C			
Storage temperature	-10°C to +55°C		o +55°C	
Cable length	1.9 m between sensor		1.9 m between sensor and	
	and counter		AMP BOX 100 mm between	
			AMP BOX and counter	
Mass Approx. 150 g including of		able	Approx. 200 g including	
			AMP BOX and cable	
Accessory	Dustproof Rubber Boot Ins		truction Manual	
Option	Finger lift	AA-96	69	
	Release AA-8		13, AA-816	
	· · · · · · · · · · · · · · · · · · ·		973(with a mesuring chip)	
Gauge stand		ST-011, ST-022		
			various probes	
			402 connection joint forexchanging	
			ring chips	
	(when AA-		n AA-973 dust-proof boot is used)	

*It is available when our digital gauge counter is used.

The value, whih is written at (), is maximum response speed when it is combined with our model DG-4140/4160.

■ Outside Drawing

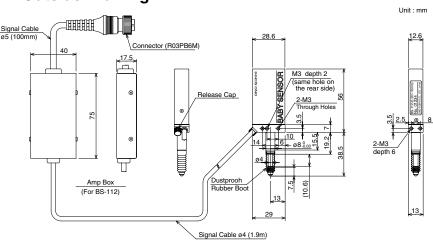

■ Omission of Test Qualification Issuance

Since this product has been tested through a series of strict inspections and a complete program of quality control, issuance of the test qualification has been omitted.

Warranty

- This product is covered by a warranty for a period of one year from the date of purchase.
- This warranty covers free-of-charge repair for defects judged to be the responsibility of the manufacturer, i.e., defects occurred while the product is used under normal operating conditions according to descriptions in this manual and notices on the unit label.
- For free-of-charge repair, contact either your sales representative or our sales office nearby.
- The following failures will be handled on a fee basis even during the warranty period.

 (a) Failures occurring through misuse, mis-operation, or modification

 (b) Failures occurring through mishandling (dropping) or transportation
- (c) Failures occurring through natural calamities (fires, earthquakes, flooding, and lightening), environmental disruption, or
- * For repairs after the warranty period expired, contact your sales representative or our sales office nearby.

ONO SOKKI

*Outer appearance and specifications are subject to change without prior notice. HOME PAGE: http://www.onosokki.co.jp/English/english.htm

WORLDWIDE

Ono Sokki Co., Ltd

1-16-1 Hakusan, Midori-ku, Yokohama 226-8507, Japan Phone : 045-935-3976 Fax : 045-930-1906 E-mail : overseas@on

BSシリーズ ベビーゲージセンサ

BS-102 / 112

取扱説明書

このたびは、小野測器のBS-102/112ベビーゲージセンサをご採用いただきまして、誠 にありがとうございます。本器の性能を充分に生かして、ご使用いただくために、ご一 読をお願いいたします。

また、お読みになった後も、大切に保管してください。

ご使用に際しての注意


- (1) ベビーゲージセンサを分解することは、故障の原因となります。
 - ベビーゲージセンサのカバーを開けますと、内部に切粉や切削油などのゴミ、ホコ リが入り故障の原因となりますので、絶対に開けないでください。カバーを開けた 場合には、保証期間内でも保証の対象とはならなくなりますので、ご注意ください。
- (2)精密機器ですので、落としたり急激な衝撃を加えたりしないように取扱いには十分 ご注意ください。
- (3)スピンドルは、油やゴミを嫌います。スピンドルに注油したり、手の脂などが付着 しますと、スピンドルの動きが悪くなりますので、スピンドルに注油したり、素手 で触ることは避けてください。

また、スピンドルに付着した油(脂)やゴミをふき取る場合には、乾いた柔らかい 布または、無水アルコールを湿らせた柔らかい布でふき取ってください(ベンジン、 シンナー、ガソリンなどは使用しなしでください)。

- (4)スピンドルには横方向の力を加えないでください。 スピンドルと軸受の関係は、非常に精密に加工されていますので、スピンドルに横 方向の力を加えたり、ステムを必要以上の力で締め付けるとスピンドルの動きが悪
- (5) スピンドルに取り付けてあるリングは、ストッパーになっていますので、絶対に外 さないでください。
- (6) 測定子の交換

くなります。

測定子を交換する場合には、スピンドルにねじれ力が加 わらないように十分にご注意ください。もし、測定子が 緩まない場合には、図のようにスピンドルにゴムバンド を巻き、手でしっかりとおさえて、測定子を回してくだ さい。また、測定子を取り付ける場合も同様に行ってく ださい。

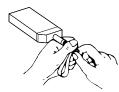

スピンドルの操作について

(1) スピンドルの追従速度は、BS-102 は 1m/s、BS-112 は 0.2m/s となっています。この 速度以上で動かしますと、誤作動をすることがあります。

また、被測定体へスピンドルを当てるときは、1mm以内に近づけてからスピンドル を落下させるのが、望ましい使い方です。

(2)オプションのレリーズを使用する場合、本体のレリーズ取付穴用ふたをはずし、ね じ込んで取り付けてください。レリーズを押すとスピンドルが押し上げられます。 急激に押し上げたり、勢いよく離したりしないでください。

(ゲージスタンド ST-011 / 022 に取り付けてレリーズを使用する場合は、右側にレ リーズが出るようになります。)

(3) スピンドルを基準面に当てない状態では、正確な定点とはなりません。必ず、スピ ンドルを基準面に当てて、押し込んだ状態を基準点としてください。

センサの取付方法

本器を取り付けるには、次の二つの方法があります。ス ピンドルの移動方向と被測定物の長さの方向が一致する ように固定してください。

(1) ステムをつかんで固定する方法

ステムの直径は

ø


8 mmに仕上げられていま


すので、 $\phi 8_{+0.01}^{+0.03}$ mm の取付穴を加工してステム に必要以上の力がかからないように締め付け てください。


(2)取付穴で固定する方法


M3のナベビスまたは六角穴付ボルトを使用し て取り付けます。

(センサの3面にM3のネジが切ってあります ので、取り付けやすい方向をお選びくださ い。)

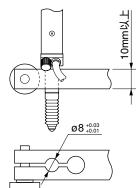

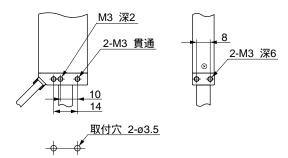

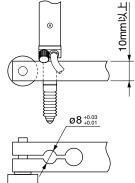

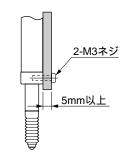


仕様

	1	i		
型名	BS-102	BS-112		
測定範囲	10 mm	10 mm		
測定単位	10 μ m	1 μ m		
指示精度	3 μ m (20)	3 μ m (20)		
最大応答速度	1 (4) m/s*	0.2(0.8) m/s*		
測定力	1.47 N以下(防塵ゴムをはずした場合 0.98 N以下)			
	*オプションにて測定力改造可	*オプションにて測定力改造可能範囲(0.39 N ~ 0.98 N)		
供給電源電圧	DC 4.5 V ~ 6.0 V			
消費電流	約30 mA(DC5 Vにおいて) 約70 mA(DC5 Vにおいて)			
出力信号	2相方形波信号			
	位相差 90°± 20°(DC5 V において)			
	Hi:4.5 V ~ 6.0 V (無負荷時)			
	Lo:0.4 V以下 BS-102:P=40 μm/BS-112:P=4 μm			
	 P			
	信号1 」			
	信号2			
	スピンドルを押し込む時 引き出す時			
端末コネクタ	R03-PB6M (多治見無線)			
	ゲージセンサ コネクタ カウンタ			
	信号 1 信号 1			
	信号 2 信号 2			
	電源入力 +			
	信号コモン オレンジ / 緑 □ 電源出力 -			
	電源入力 - (BS-102 / 112) F (
	センサ内では、ケースと信号コモン間は接続されていません。			
使用温度範囲	+ 5 ~ + 40			
保存温度範囲	- 10 ~ + 55			
コード長	センサ~カウンタ間 1.9 m	センサ ~ アンプ間 1.9 m		
		アンプ~カウンタ間 100 mm		
	* オプション延長ケーブルにて	· 30 m まで延長可能		
質量	約 150 g	約 200g		
	(ケーブル含む)	- (ケーブル、アンプボックス含む)		
	防塵ゴム・取扱説明書			
オプション	レリーズ (AA-813 / 816)			
	フィンガーリフト (AA-969)			
	ゲージスタンド (ST-011 / 022)			
	取替用防塵ゴム (測定子付) AA-973			
	測定子各種(防塵ゴムとの併用不可)			
	測定子交換用継手 AA-8402 (防塵ゴムとの併用のとき)			
当社ゲージカウンタ使用時。				

カウンタ使用時。

()内はDG-4140/4160で使用した時の最大応答速度です。

外形寸法図

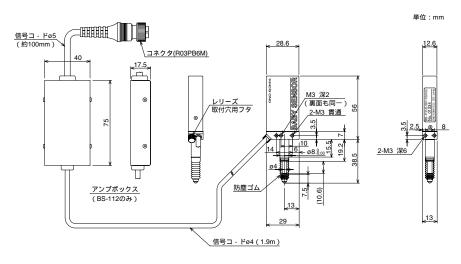

検査合格証の省略について

本製品は、工場出荷に際して弊社の厳重な出荷検査を受け、正常に動作することが確認されておりますが、検査合格証の発行は省略しております。あらかじめご了承ください。

輸出または国外へ持ち出す際のご注意

#制山めた[は四月] 「引き」」。「はいったがして江西 本製品(役務を含む)を輸出または国外へ持ち出す際は、外国為替および外国貿易管理法の規定により、法令該当品の 場合、日本国政府(通商産業省)への輸出許可申請の手続きが必要となります。また、非該当品であっても、通関上非 該当判定書を要する場合があります。輸出または国外へ持ち出す際は、弊社までご相談ください。

保証規定

- 保証規定
 ・お買い上げ日から一年間は保証期間です。故障の場合には無償にて修理いたします。
 ・保証期間内であっても、次のような場合には有償修理になります。
 ・使用上の誤りおよび不当な修理や改造等による故障や損傷・お買い求めいただいた後の取り付け場所移動時などでの故障や損傷・お

- や損傷 ・火災、地震、水害、落雷、その他天災地変、公害や異常電圧 等による故障や損傷 ・消耗品、予備品、付属品等の補充 3 本保証規定は日本国内においてのみ有効です。

- This warranty is valid only in Japan.

 ・保証期間後の修理などについてご不明な場合は、お買い 求めの販売店または弊社までお問い合せください。

ONO SOKKI

株式会社 小野測器

〒226-8507 神奈川県横浜市緑区白山1-16-1

お客様相談室

フリーダイヤル **100** 0120-388841

FAX 0120-045935

Copyright © ONO SOKKI Co.,Ltd. 2005 All rights reserved. B00000113 / IM89051001(8) 05X(MS)XXX